

LIST OF PLATES

Plate No.		Page No.
1	Oblique Aerial View of the Study Area (Photograph taken on 30 June 2000)	81
2	Oblique Aerial View of Landslides B and C (Photograph taken on 30 June 2000)	82
3	View of the Alluvial Outwash Debris on the Leung King Estate Perimeter Road (Photograph taken by MCA on 14 April 2000)	83
4	View of the Blocked and Overflowing Slope Drainage Below the Source Area of Landslide B (Photograph taken by MCA on 14 April 2000)	84
5	View of the Blocked and Overflowing Slope Drainage Below the Source Area of Landslide C (Photograph taken by MCA on 14 April 2000)	85
6	View of the Alluvial Outwash Debris and Damaged Pedestrian Railing Below Drainage Line DC3 (Photograph taken by MCA on 14 April 2000)	86
7	Panoramic View of the Western Flank of Landslide B (Photograph taken on 24 October 2000)	87
8	View of the Floor of Landslide B (Photograph taken on 24 October 2000)	88
9	Panoramic View of the Eastern Flank of Landslide B (Photograph taken on 24 October 2000)	89
10	Panoramic View Looking Down from the Crown of Landslide B (Photograph taken on 12 October 2000)	90
11	Oblique Aerial View of the Exposed Granite Cliff above Landslide B (Photograph taken on 30 June 2000)	91
12	Detail of Quartz Vein Offset by a Joint on the Eastern Flank of Landslide B (Photograph taken on 24 October 2000)	92

Plate No.		Page No.
13	Detail of West Face of Trial Trench LKTT1. Note Offset Joints and Clay Infills (Figure 20) (Photograph taken on 12 October 2000)	93
14	Detail of Offset Clay Infilled Joint on the Floor of Landslide B (Photograph taken on 12 October 2000)	94
15	Detail of Fractures Forming an Orthogonal Pattern on the Floor of Landslide B (Photograph taken on 12 October 2000)	95
16	Detail of Partially Radial Fractures on the Floor of Landslide B (Photograph taken on 5 July 2000)	96
17	Panoramic View of Eastern Release Surface of Landslide B. Note Open and Sediment-infilled Joints (Photograph taken on 14 July 2000)	97
18	Detail of Open and Sediment-infilled Joints Exposed on the Eastern Release Surface (Photograph taken on 14 July 2000)	98
19	Detail of Crown of Landslide B (Photograph taken on 10 October 2000)	99
20	Erosion Pipe Located on the Western Flank of Landslide B (Photograph taken on 24 October 2000)	100
21	Erosion Pipe Located Below the Crown of Landslide B (Photograph taken on 12 October 2000)	101
22	Erosion Pipe Located at the Intersection of Two Joints within Highly Decomposed Granite on the Floor of Landslide B (Photograph taken on 4 July 2000)	102
23	Detail of Minor Seepage from Sheeting Joint Exposed on the Floor of Landslide B (Photograph taken on 28 October 2000)	103
24	Main Scarp of Landslide B1 (Photograph taken on 24 October 2000)	104
25	Oblique Aerial View of the Upper Section of the Debris Trail Below Landslide B (Photograph taken on 30 June 2000)	105

Plate No.		Page No.
26	Possible Breached Dam Below Landslide B between Chainages 65 and 95 (Photograph taken on 8 June 2000)	106
27	View of a Minor Failure on Western Flank of Drainage Line at Chainage 140 (Photograph taken on 8 June 2000)	107
28	View of Debris Lobe Located between Chainages 210 and 240 (Photograph taken on 8 June 2000)	108
29	View of Eroded Channel within the Colluvium Substrate (Note the 2 m Diameter Boulder at Chainage 250. Photograph taken on 6 June 2000)	109
30	View of the Distal End of the Debris Lobe Covering the Gently Inclined Slope between Chainages 310 and 360 (Photograph taken on 6 June 2000)	110
31	View of the Sheet Deposit of Sorted Debris at the Distal End of the Debris Trail at Chainage 365 (Photograph taken on 6 June 2000)	111
32	View of the Western Flank of Landslide C (Photograph taken on 18 September 2000)	112
33	View of the Eastern Flank of Landslide C (Photograph taken on 18 September 2000)	113
34	Erosion Pipe with V-shaped Washout Feature Below (Photograph taken on 9 June 2000)	114
35	View of Eroded Channel within Mining Waste Located Directly Below the Source Area of Landslide C (Photograph taken on 18 September 2000)	115
36	View of Debris Lobe Below Landslide C between Chainages 45 and 60 (Photograph taken on 18 September 2000)	116
37	View of Debris Trail above Chainage 100. (Note Parallel Debris Lobes Flanking Eroded Channel. Photograph taken on 9 June 2000)	117
38	View of Random Rubble Retaining Wall at Chainage 106 (Photograph taken on 9 June 2000)	118

Plate No.		Page No.
39	General View of Landslide C3 (Photograph taken on 24 October 2000)	119
40	General View of Landslide C4 (Photograph taken on 24 October 2000)	120
41	Samples of Molybdenite and Quartz Found within the Mining Waste Below Landslide C (Photograph taken on 24 October 2000)	121
42	Oblique Aerial View Showing the Cut Slopes Formed During the Mining Works before 1945 (Photograph taken on 30 June 2000)	122
43	Panoramic View of the Mining Cut Slope to the East of Landslide C (Note Landslide C on the Left, Slope Strip LKSS4 in the Centre and Trial Pit LKTP6 on the Right. Photograph taken on 24 October 2000)	123
44	Panoramic View of the Mining Cut Slope About 30 m to the East of Landslide C (Note Slope Strip LKSS5 and Mining Excavation in the Foreground. Photograph taken on 24 October 2000)	124



Plate 1 - Oblique Aerial View of the Study Area
(Photograph taken on 30 June 2000)



Plate 2 - Oblique Aerial View of Landslides B and C
(Photograph taken on 30 June 2000)

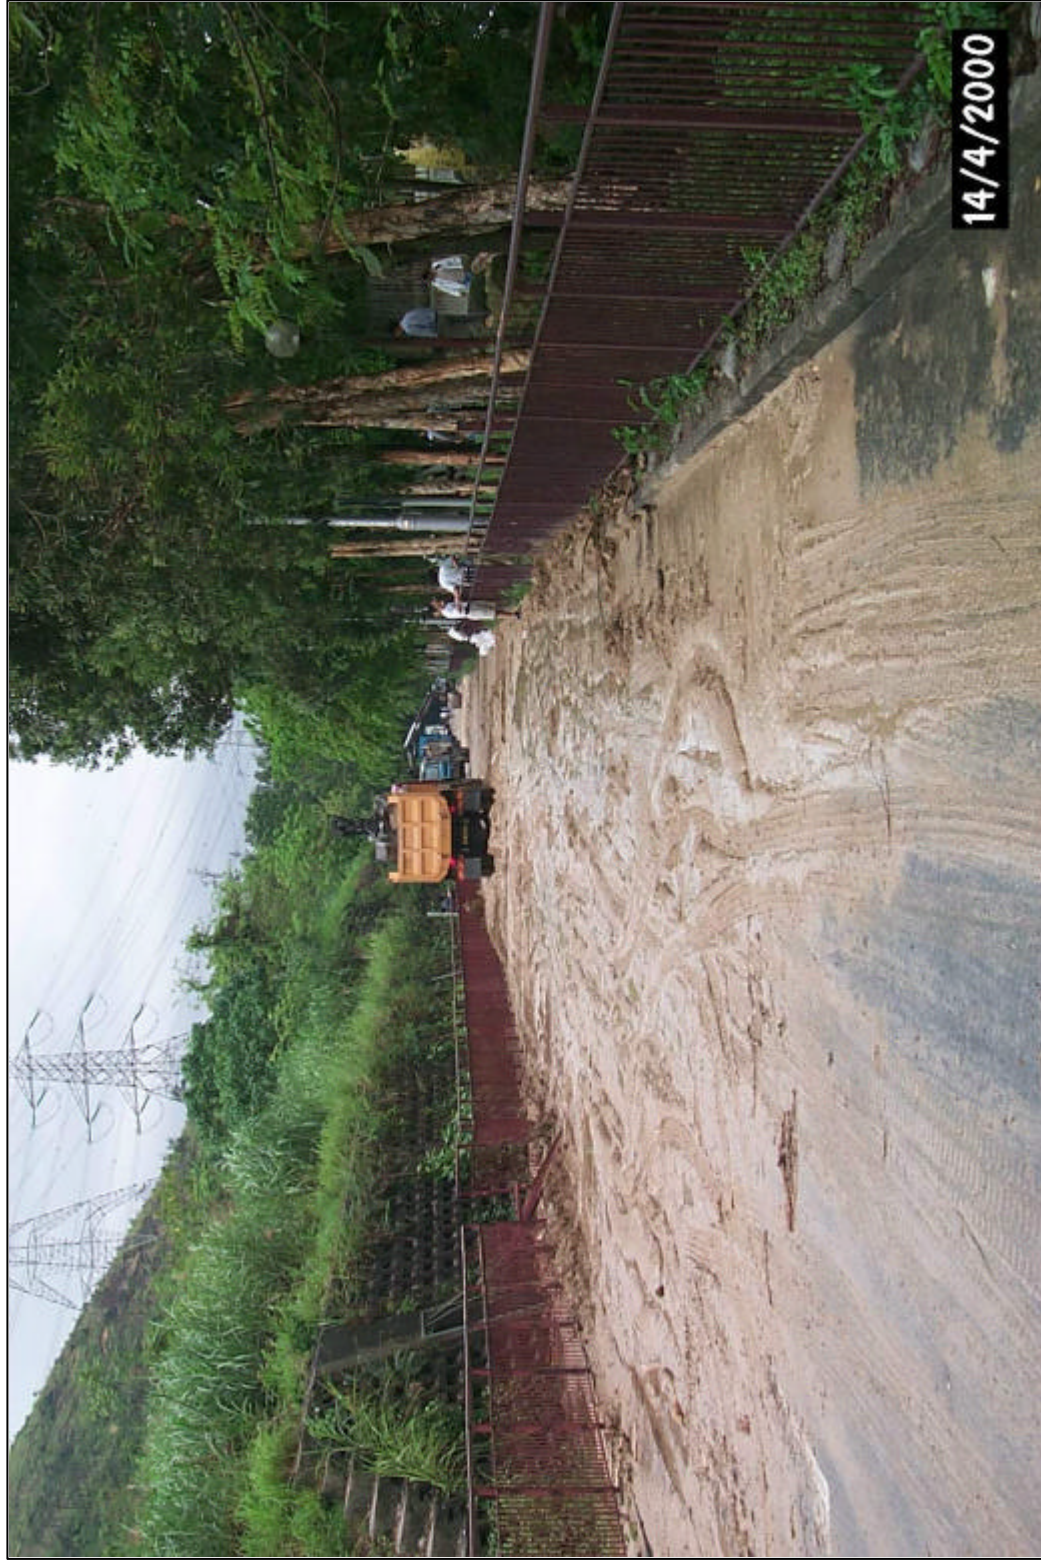


Plate 3 - View of the Alluvial Outwash Debris on the Leung King Estate Perimeter Road
(Photograph taken by MCA on 14 April 2000)

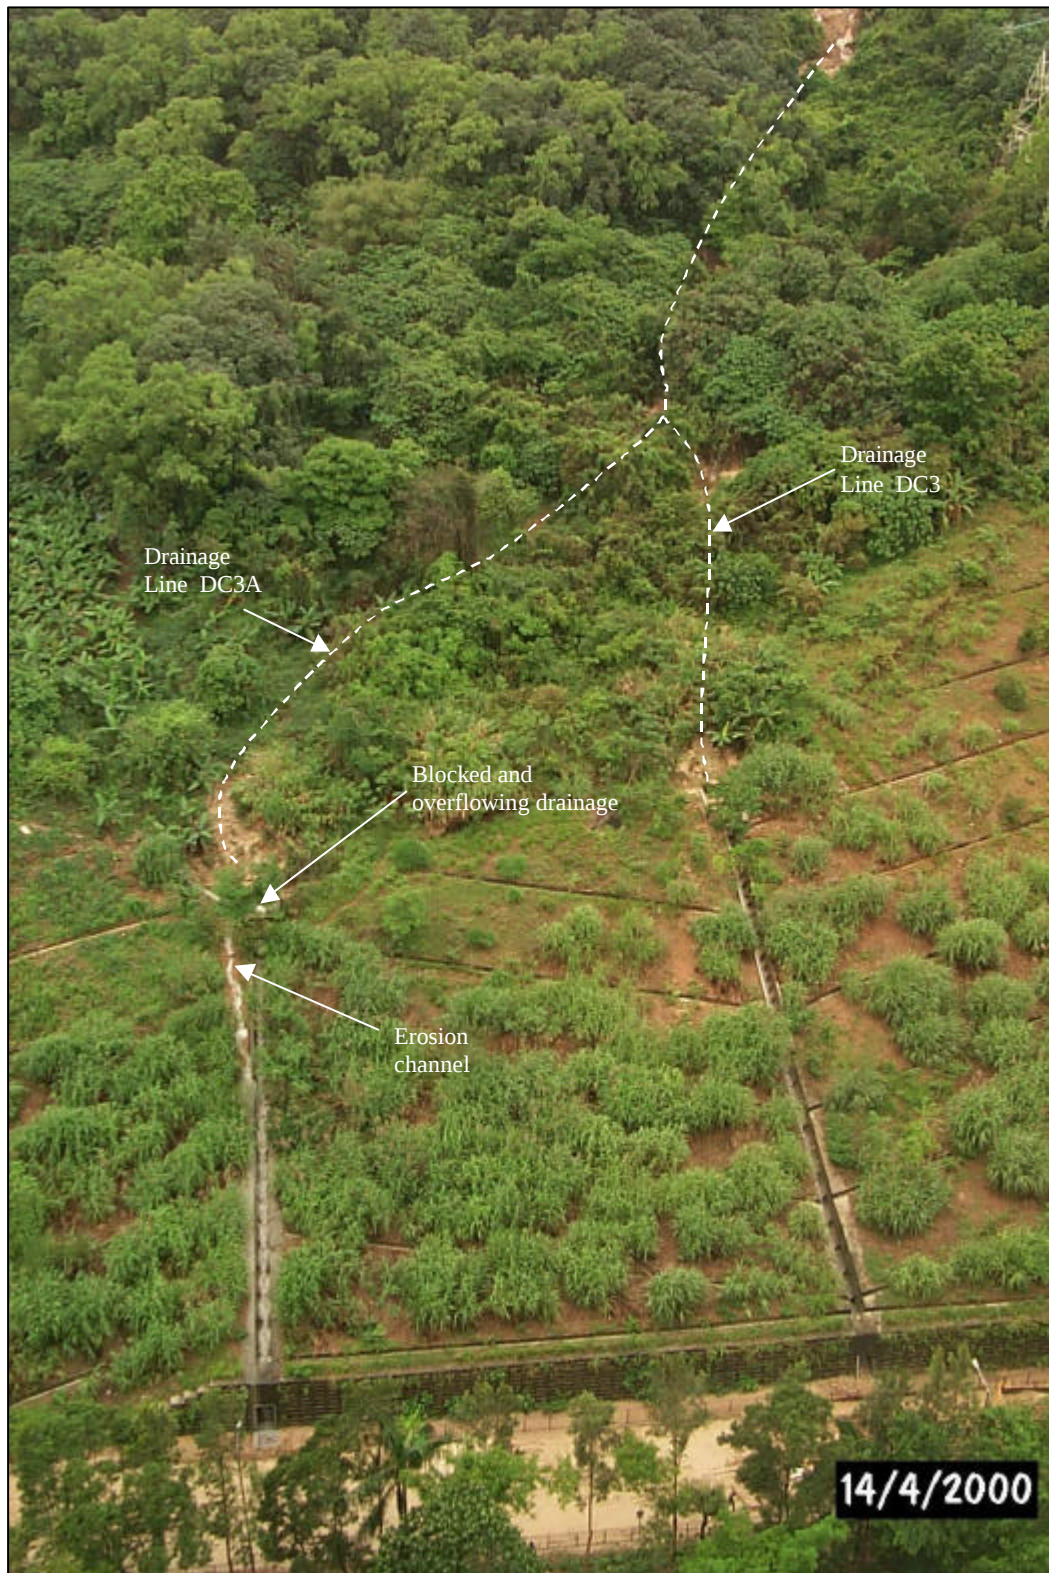


Plate 4 - View of the Blocked and Overflowing Slope Drainage
Below the Source Area of Landslide B
(Photograph taken by MCA on 14 April 2000)



Plate 5 - View of the Blocked and Overflowing Slope Drainage
Below the Source Area Landslide C
(Photograph taken by MCA on 14 April 2000)



Plate 6 - View of the Alluvial Outwash Debris and Damaged Pedestrian Railing Below Drainage Line DC3
(Photograph taken by MCA on 14 April 2000)



Plate 7 - Panoramic View of the Western Flank of Landslide B
(Photograph taken on 24 October 2000)



Plate 8 - View of the Floor of Landslide B
(Photograph taken on 24 October 2000)



Plate 9 - Panoramic View of the Eastern Flank of Landslide B
(Photograph taken on 24 October 2000)



Plate 10 - Panoramic View Looking Down from the Crown of Landslide B
(Photograph taken on 12 October 2000)

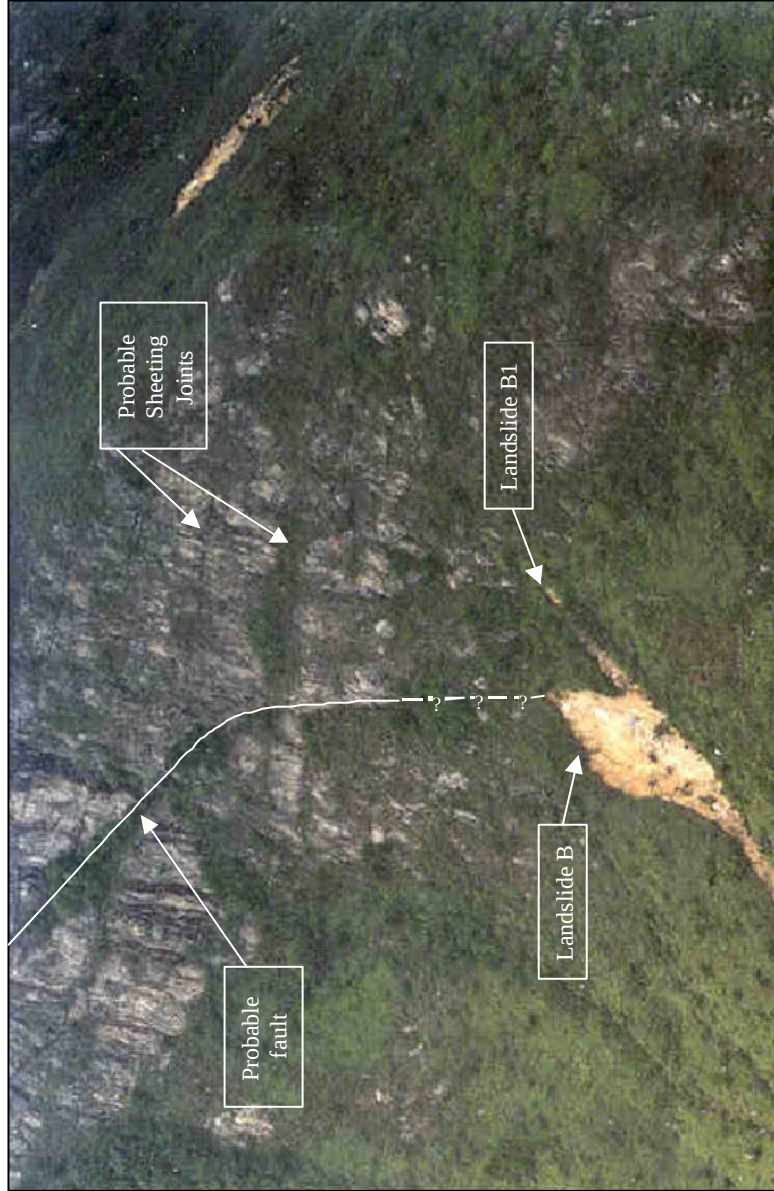


Plate 11 - Oblique Aerial View of the Exposed Granite Cliff above Landslide B
(Photograph taken on 30 June 2000)

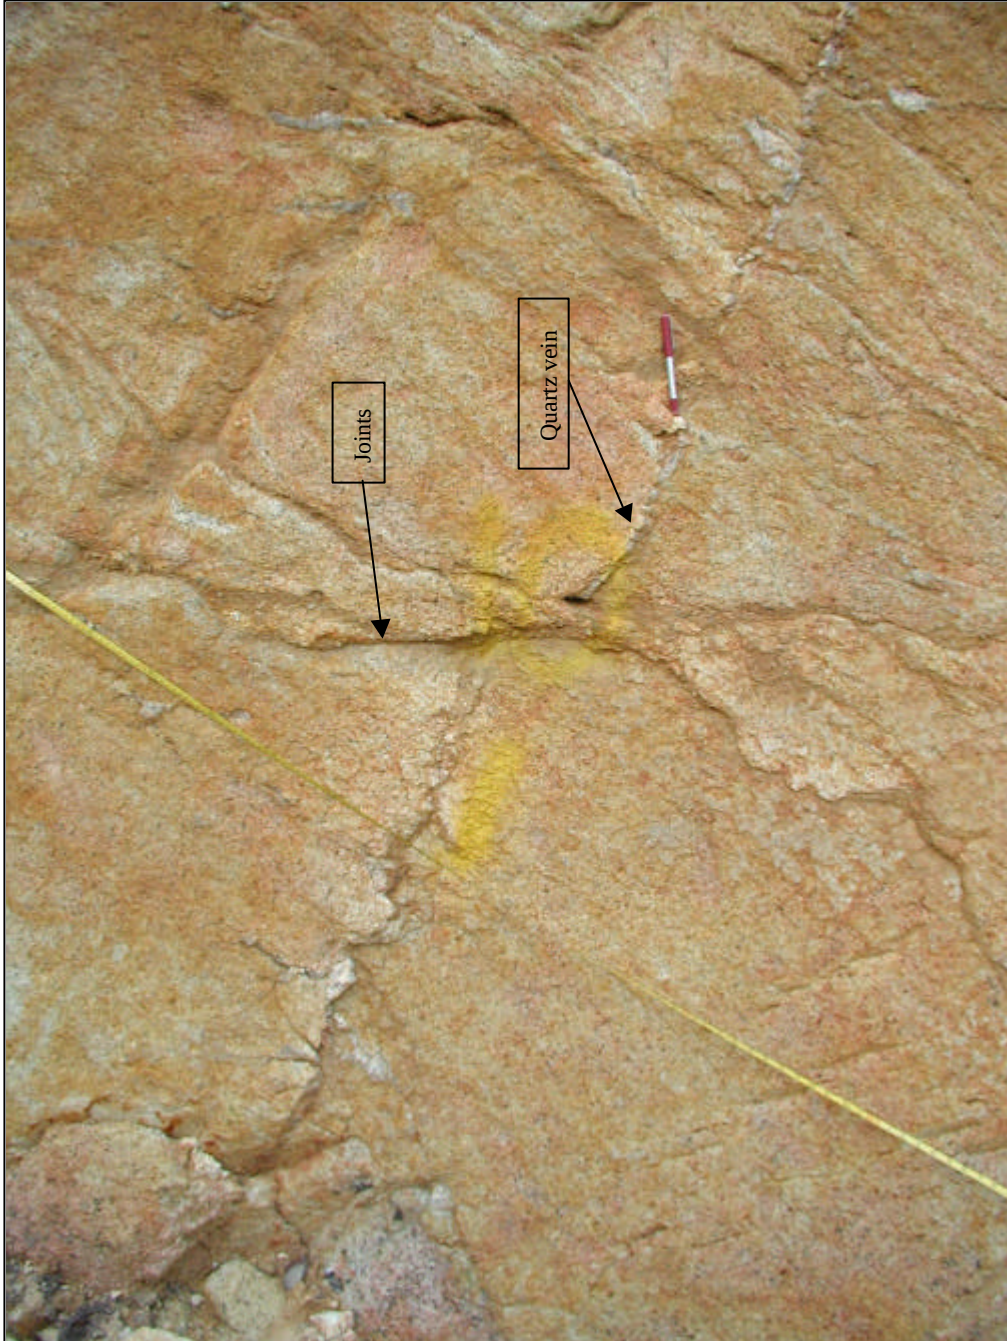


Plate 12 - Detail of Quartz Vein Offset by a Joint on the Eastern Flank of Landslide B
(Photograph taken on 24 October 2000)

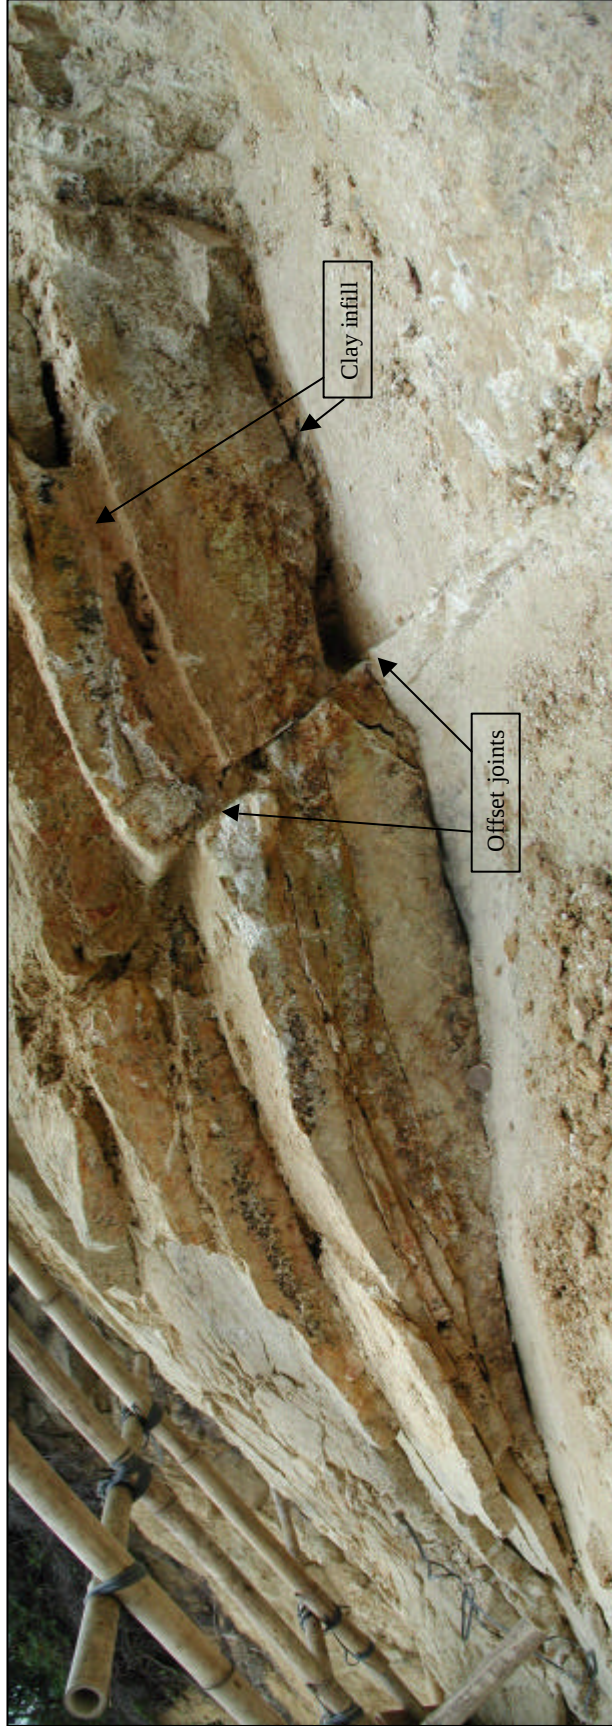


Plate 13 - Detail of West Face of Trial Trench LKTT1. Note Offset Joints and Clay Infills (Figure 20)
(Photograph taken on 12 October 2000)



Plate 14 - Detail of Offset Clay Infilled Joint on the Floor of Landslide B
(Photograph taken on 12 October 2000)



Plate 15 - Detail of Fractures Forming an Orthogonal Pattern on the Floor of Landslide B
(Photograph taken on 12 October 2000)



Plate 16 - Detail of Partially Radial Fractures on the Floor of Landslide B
(Photograph taken on 5 July 2000)



Plate 17 - Panoramic View of Eastern Release Surface of Landslide B. Note Open and Sediment-infilled Joints
(Photograph taken on 14 July 2000)



Plate 18 - Detail of Open and Sediment-infilled Joints Exposed on the Eastern Release Surface
(Photograph taken on 14 July 2000)



Plate 19 - Detail of Crown of Landslide B
(Photograph taken on 10 October 2000)



Plate 20 - Erosion Pipe Located on the Western Flank of Landslide B
(Photograph taken on 24 October 2000)



Plate 21 - Erosion Pipe Located Below the Crown of Landslide B
(Photograph taken on 12 October 2000)



Plate 22 - Erosion Pipe Located at the Intersection of Two Joints
within Highly Decomposed Granite on the Floor of Landslide B
(Photograph taken on 4 July 2000)



Plate 23 - Detail of Minor Seepage from Sheetting Joint Exposed on the Floor of Landslide B
(Photograph taken on 28 October 2000)



Plate 24 - Main Scarp of Landslide B1
(Photograph taken on 24 October 2000)



Plate 25 - Oblique Aerial View of the Upper Section of the Debris Trail Below Landslide B
(Photograph taken on 30 June 2000)



Plate 26 - Possible Breached Dam Below Landslide B Between Chainages 65 and 95
(Photograph taken on 8 June 2000)

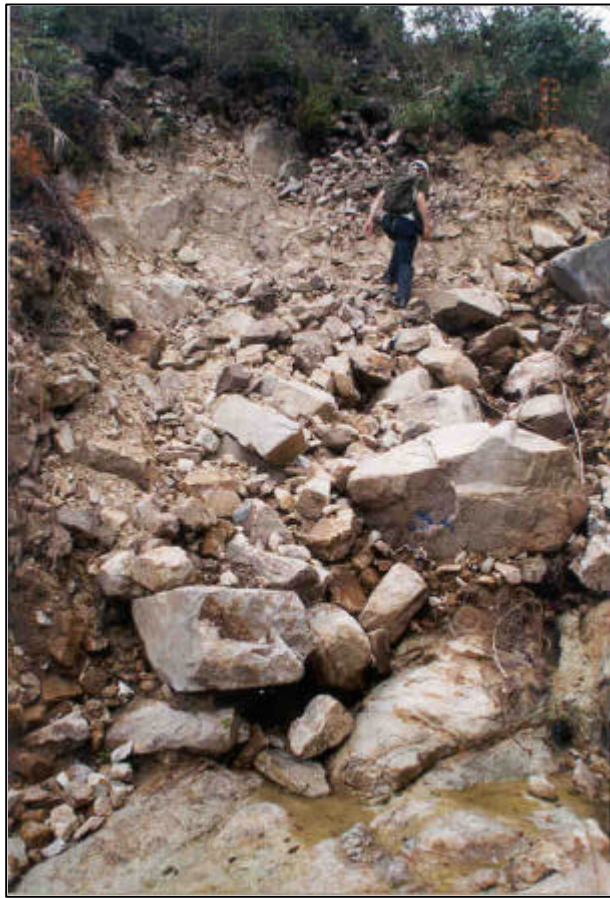


Plate 27 - View of a Minor Failure on Western Flank of
Drainage Line at Chainage 140
(Photograph taken on 8 June 2000)



Plate 28 - View of Debris Lobe Located between Chainages 210 and 240
(Photograph taken on 8 June 2000)



Plate 29 - View of Eroded Channel within the Colluvium Substrate
(Note the 2 m Diameter Boulder at Chainage 250.
Photograph taken on 6 June 2000)



Plate 30 - View of the Distal End of the Debris Lobe Covering the Gently Inclined Slope between Chainages 310 and 360
(Photograph taken on 6 June 2000)



Plate 31 - View of the Sheet Deposit of Sorted Debris
at the Distal End of the Debris Trail at Chainage 365
(Photograph taken on 6 June 2000)



Plate 32 - View of the Western Flank of Landslide C
(Photograph taken on 18 September 2000)



Plate 33 - View of the Eastern Flank of Landslide C
(Photograph taken on 18 September 2000)



Plate 34 - Erosion Pipe with V-shaped Washout Feature Below
(Photograph taken on 9 June 2000)



Plate 35 - View of Eroded Channel within Mining Waste Located
Directly Below the Source Area of Landslide C
(Photograph taken on 18 September 2000)



Plate 36 - View of Debris Lobe Below Landslide C between Chainages 45 and 60
(Photograph taken on 18 September 2000)



Plate 37 - View of Debris Trail above Chainage 100.
(Note Parallel Debris Lobes Flanking Eroded Channel.
Photograph taken on 9 June 2000)



Plate 38 - View of Random Rubble Retaining Wall at Chainage 106
(Photograph taken on 9 June 2000)



Plate 39 - General View of Landslide C3
(Photograph taken on 24 October 2000)



Plate 40 - General View of Landslide C4
(Photograph taken on 24 October 2000)



Plate 41 - Samples of Molybdenite and Quartz Found within the Mining Waste Below Landslide C
(Photograph taken on 24 October 2000)



Plate 42 - Oblique Aerial View Showing the Cut Slopes Formed
During the Mining Works before 1945
(Photograph taken on 30 June 2000)



Plate 43 - Panoramic View of the Mining Cut Slope to the East of Landslide C
(Note Landslide C on the Left, Slope Strip LKSS4 in the Centre and Trial Pit LKTP6 on the Right.
Photograph taken on 24 October 2000)



Plate 44 - Panoramic View of the Mining Cut Slope About 30 m to the East of Landslide C
(Note Slope Strip LKSS5 and Mining Excavation in the Foreground.
Photograph taken on 24 October 2000)